

Work Order ID 132138

Tuesday, April 28, 2015 10:24:17 AM

132138

Page 1

Item ID: D2580-1

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: 205 Bent Tube

Start Date: 4/28/2015 Start Qty: 4.00 ***4***

Cust Item ID:

Required Date: 5/8/2015 Req'd Qty: 4.00 ***4***

Customer:

Reference:

Approvals: Process Plan: UMF Date: 15-4-29 Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
D2580	G

100

0.00

100

Skidtubes

Skidtubes

Memo

0.00

1- Inspect mat'l D2500-1-190 for damage.

2-Drill pilot holes using drill jig DT 8149 A-BC-D

3-Open holes to 0.508" as per Dwg D2580

4-Deburr holes per QSI002 section 4.2.3 and blow out all chips from inside of tube

5- Test fit inspection saddles on FWD & AFT saddle holes using DT9916.

101

QC6- Inspect dimensions to drawing

0.00

101

QC

Quality Control

Memo

0.00

4 & 15-5-6 DGE
15-5-6

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition			Completed By																		
Root Cause		FAULT CATEGORY																							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mis-labeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : ☐																			

Work Order ID 132138

Tuesday, April 28, 2015 10:24:17 AM

132138

Page 2

Item ID: D2580-1 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: 205 Bent Tube
 Start Date: 4/28/2015 Start Qty: 4.00 ***4*** Cust Item ID:
 Required Date: 5/8/2015 Req'd Qty: 4.00 ***4*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110	Chemical Conversion Coat per QSI005 4.1	0.00							
110									
HandFinish	Memo	0.00				4	15-5-6		
Hand Finishing									
120	QC7-Inspect Chemical Conversion Coat	0.00							
120									
QC	Memo	0.00							
Quality Control									
125		0.00							
125									
Skidtubes	Memo	0.00				1	15-5-6		
Skidtubes	1- Bond web in place per QSI 015.								
	A/R Sikaflex-291 batch: <u>131574</u>								
	Sikaflex expire date: <u>15-10-21</u>								
	Start time and date: <u>7:00 pm</u> bond for 12hrs								

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 132138

Tuesday, April 28, 2015 10:24:17 AM

132138

Page 3

Item ID: D2580-1 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: 205 Bent Tube
 Start Date: 4/28/2015 Start Qty: 4.00 ***4*** Cust Item ID:
 Required Date: 5/8/2015 Req'd Qty: 4.00 ***4*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130	QC5- Inspect part completeness to step on W/O	0.00							
130						4	0	BE	
QC	Memo	0.00						15-05-07	
Quality Control									
140	Identify as per dwg & Stock Location: <u>L/G</u>	0.00							
140						4	0	15-5-7	Dec
Packaging	Memo	0.00							
Packaging	LOCATION : LG002								
150	QC21- Final Inspection - Work Order Release	0.00							
150						MLJ			MAY 07 2015
QC	Memo	0.00							
Quality Control									
						MLJ			MAY 07 2015

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

Picklist Print

Tuesday, April 28, 2015 10:24:16 AM

Page 1

Work Order ID: 132138

132138

Parent Item: D2580-1

D2580-1

Parent Item Name: 205 Bent Tube

Start Date: 4/28/2015

Required Date: 5/8/2015

Start Qty: 4.00

Required Qty: 4.00

Comments: IPP B01.11.08 Revised Step 9, 10, 12, and 13 SM IPP Rev:C
10.12.01 as per DEO D1 DD ver:ec

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D2500-1-190

Manufactured No

100

Each

64.0000

1

4

D2500-1-190

Ext'n -I' Beam Tube 4"

Location

Loc Qty

Loc Code

LG002

64

120085

64

D2596

Manufactured No

100

Each

4.0000

1

4

D2596

Web, 205 Skidtube

Location

Loc Qty

Loc Code

LG002

4

131639

4

DGL 15-5-6.

132140 x4 15-5-6 DGL

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : ☐					

LIST OF MATERIALS					
ITEM	QTY -041	QTY -045	QTY -047	QTY -049	PART NUMBER
1	X				D2580-041
2		X			D2580-045
3			X		D2580-047
4				X	D2580-049
20	1	1	1	1	D2500-1-190
21			16	16	D2570
22	1	1	1	1	D2576-3
23		4			D2579
24	16	16	8	8	D2594-1
25	16	16	8	8	D2594-3
26	1	1	1	1	D2596
27	1	1	1	1	D2855
28	1	1			D3564-5
29	1	1			D3564-9
30	1	1			D3564-11
31	1	1			D3564-13
32	2	2			D3566-1
33	1	1			D3566-5
34	1	1			D3566-13
35	20	20	24	24	D4202-1
36			1		D4406-041
37			1		D4406-043
37				1	D5061-1
37				1	D5061-3
50	50	50			ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130
51	50	50			AN3C4A
52	2	2	2	2	AN3-5A
53			8	8	AN4-45A
54	50	50			NAS1149C0332R
55	2	2	2	2	NAS1149D0332J
56			8	8	MS21042-4

GENERAL NOTES:

- MATERIAL: N/A
- FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3 POWDER COAT ASSEMBLY (-045) GREEN SANDTEX (REF 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: NONE
- WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- WELDING PER DART QSI 004.
- INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-291.
- INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2014-04-29

G	ADDED -049, -047 WEIGHT UPDATED PER DSI 9598	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	DS	D2580	SHEET 1 OF 9
APPROVED	DS	TITLE	SCALE
DE APPR.	DS	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								




RELEASED
2014-04-29

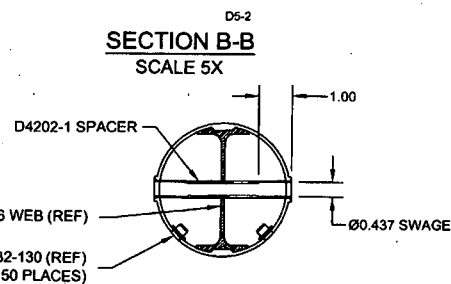

**AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:**

- 1. INSERT D4202-1 SPACER (20 PLACES)**
- 2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002**
- 3. TRIM / GRIND FLUSH PER QSI 002**

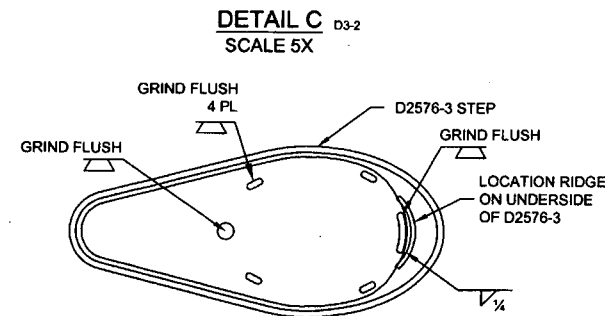

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>AP</i>	DRAWING NO.	REV. C
MFG. APPR.	<i>AP</i>	D2580	SHEET 2 OF 6
APPROVED	<i>AP</i>	TITLE	SCALE
DE APPR.	<i>AP</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED TO THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR QUALIFICATION TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

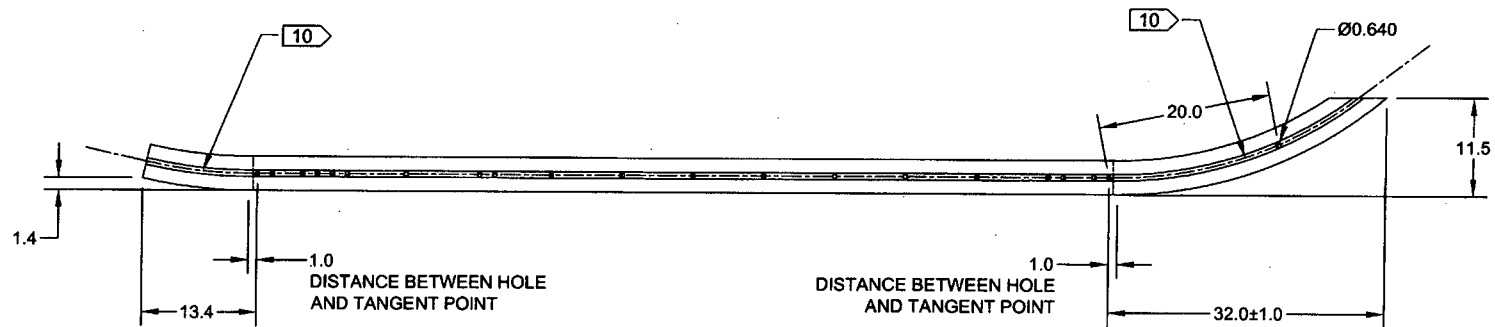

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 3 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____


Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval	
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

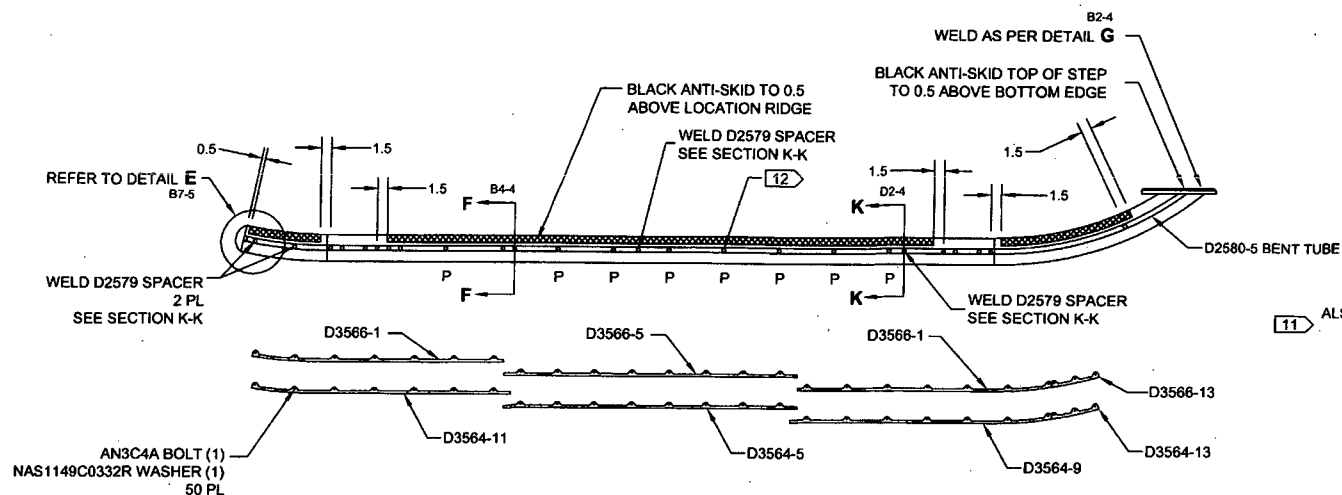


D2580-045 ASSEMBLY DETAIL

SECTION K-K D5-4
SCALE 5X

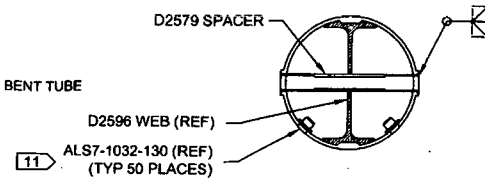


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (4 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. DO NOT C'BORE

DETAIL E D7-4
SCALE 5X

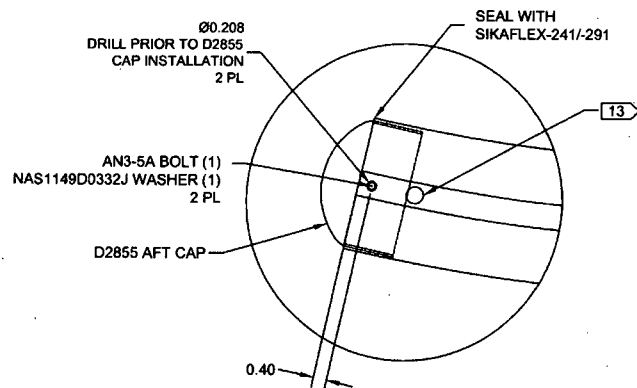


SECTION F-F D5-4
SCALE 5X

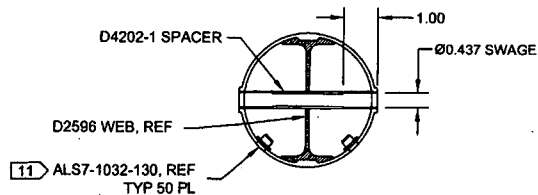

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

DETAIL G D3-4
SCALE 5X

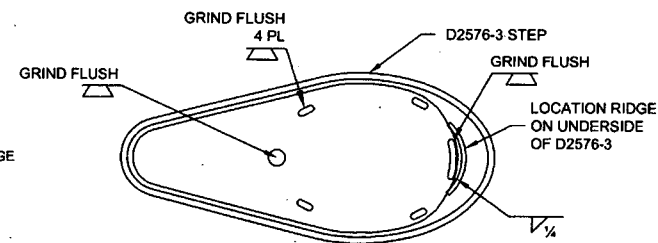

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	AJS	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 4 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

RELEASED
2014-04-29

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐				FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : ☐									

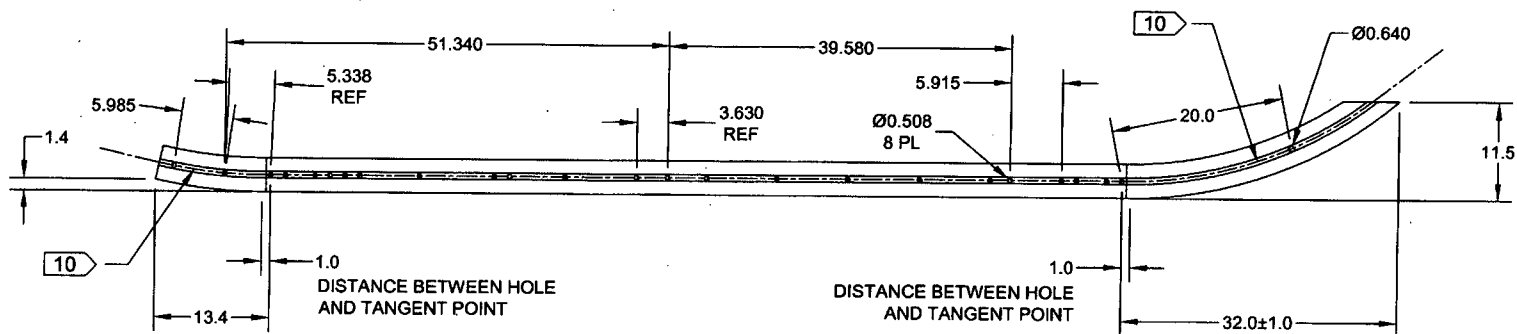

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	A.P.	D2580	SHEET 5 OF 9
APPROVED	A.P.	TITLE	SCALE
DE APPR.	A.P.	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1998 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>				Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																	
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																	
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																	
Large Fab ☐	Composite ☐	Supplier ☐																																																																		
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval																																																																
Description Work Order Deviation		Disposition		Completed By																																																																
				Lead hand / Supervisor Approval Verification																																																																
				QC / QA Coordinator Approval																																																																
Root Cause		FAULT CATEGORY																																																																		
<table style="width:100%; border: none;"> <tr><td style="border: none;">Environment ☐</td><td style="border: none;">No Re-verification ☐</td></tr> <tr><td style="border: none;">Design ☐</td><td style="border: none;">Operator ☐</td></tr> <tr><td style="border: none;">Doc/Data ☐</td><td style="border: none;">Offset/Setup ☐</td></tr> <tr><td style="border: none;">Equip/Tooling ☐</td><td style="border: none;">Supplier ☐</td></tr> <tr><td style="border: none;">Handling/Pre ☐</td><td style="border: none;">Training ☐</td></tr> <tr><td style="border: none;">Material ☐</td><td style="border: none;">Use for Testing ☐</td></tr> <tr><td style="border: none;">Internal Transport ☐</td><td style="border: none;">Poor Information ☐</td></tr> <tr><td style="border: none;">Tribal Knowledge ☐</td><td style="border: none;">Rushing ☐</td></tr> <tr><td style="border: none;">LOA ☐</td><td style="border: none;">Product Improvement ☐</td></tr> <tr><td style="border: none;">Substation ☐</td><td style="border: none;">Process Improvement ☐</td></tr> <tr><td style="border: none;">Past Expiry Date ☐</td><td style="border: none;">Manufacturing Process ☐</td></tr> <tr><td style="border: none;">Misidentified ☐</td><td style="border: none;">Past Due ☐</td></tr> </table>	Environment ☐	No Re-verification ☐	Design ☐	Operator ☐	Doc/Data ☐	Offset/Setup ☐	Equip/Tooling ☐	Supplier ☐	Handling/Pre ☐	Training ☐	Material ☐	Use for Testing ☐	Internal Transport ☐	Poor Information ☐	Tribal Knowledge ☐	Rushing ☐	LOA ☐	Product Improvement ☐	Substation ☐	Process Improvement ☐	Past Expiry Date ☐	Manufacturing Process ☐	Misidentified ☐	Past Due ☐	<table style="width:100%; border: none;"> <tr><td style="border: none;">☐ Pressure/Forced</td></tr> <tr><td style="border: none;">☐ Bending</td></tr> <tr><td style="border: none;">☐ Centre Not Concentric</td></tr> <tr><td style="border: none;">☐ Cracks</td></tr> <tr><td style="border: none;">☐ Crimp/Kink/Ripple/Wave</td></tr> <tr><td style="border: none;">☐ Cuffs</td></tr> <tr><td style="border: none;">☐ Crushing</td></tr> <tr><td style="border: none;">☐ Heat Treat</td></tr> <tr><td style="border: none;">☐ Wave/Twist in Tube</td></tr> <tr><td style="border: none;">☐ Marks/Chatter</td></tr> </table>	☐ Pressure/Forced	☐ Bending	☐ Centre Not Concentric	☐ Cracks	☐ Crimp/Kink/Ripple/Wave	☐ Cuffs	☐ Crushing	☐ Heat Treat	☐ Wave/Twist in Tube	☐ Marks/Chatter	<table style="width:100%; border: none;"> <tr><td style="border: none;">☐ Temperature/Cure</td></tr> <tr><td style="border: none;">☐ Set-up</td></tr> <tr><td style="border: none;">☐ BOM/Route</td></tr> <tr><td style="border: none;">☐ Broken/Damage/Defect</td></tr> <tr><td style="border: none;">☐ Inspection Incomplete/Unqualified</td></tr> <tr><td style="border: none;">☐ Contamination</td></tr> <tr><td style="border: none;">☐ Countersink</td></tr> <tr><td style="border: none;">☐ Cut Too Short</td></tr> <tr><td style="border: none;">☐ Instructions Incomplete/Unclear</td></tr> <tr><td style="border: none;">☐ Drill Holes</td></tr> </table>	☐ Temperature/Cure	☐ Set-up	☐ BOM/Route	☐ Broken/Damage/Defect	☐ Inspection Incomplete/Unqualified	☐ Contamination	☐ Countersink	☐ Cut Too Short	☐ Instructions Incomplete/Unclear	☐ Drill Holes	<table style="width:100%; border: none;"> <tr><td style="border: none;">☐ Power Loss/Surge</td></tr> <tr><td style="border: none;">☐ Folio/Program</td></tr> <tr><td style="border: none;">☐ Grain</td></tr> <tr><td style="border: none;">☐ Weld</td></tr> <tr><td style="border: none;">☐ Wrong Stock Pulled</td></tr> <tr><td style="border: none;">☐ Out of Sequence</td></tr> <tr><td style="border: none;">☐ Off-set</td></tr> <tr><td style="border: none;">☐ Mislabeled</td></tr> <tr><td style="border: none;">☐ Fit/Function</td></tr> <tr><td style="border: none;">☐ Misaligned/off center</td></tr> </table>	☐ Power Loss/Surge	☐ Folio/Program	☐ Grain	☐ Weld	☐ Wrong Stock Pulled	☐ Out of Sequence	☐ Off-set	☐ Mislabeled	☐ Fit/Function	☐ Misaligned/off center	<table style="width:100%; border: none;"> <tr><td style="border: none;">☐ Positioned Wrong</td></tr> <tr><td style="border: none;">☐ Outside Dimensions</td></tr> <tr><td style="border: none;">☐ Over/Under tolerance</td></tr> <tr><td style="border: none;">☐ Part Incorrect</td></tr> <tr><td style="border: none;">☐ Part Lost/Missing</td></tr> <tr><td style="border: none;">☐ Part Moved</td></tr> <tr><td style="border: none;">☐ Drawing</td></tr> <tr><td style="border: none;">☐ Finish</td></tr> <tr><td style="border: none;">☐ Misread</td></tr> <tr><td style="border: none;">☐ Turning Sequence</td></tr> </table>	☐ Positioned Wrong	☐ Outside Dimensions	☐ Over/Under tolerance	☐ Part Incorrect	☐ Part Lost/Missing	☐ Part Moved	☐ Drawing	☐ Finish	☐ Misread	☐ Turning Sequence
Environment ☐	No Re-verification ☐																																																																			
Design ☐	Operator ☐																																																																			
Doc/Data ☐	Offset/Setup ☐																																																																			
Equip/Tooling ☐	Supplier ☐																																																																			
Handling/Pre ☐	Training ☐																																																																			
Material ☐	Use for Testing ☐																																																																			
Internal Transport ☐	Poor Information ☐																																																																			
Tribal Knowledge ☐	Rushing ☐																																																																			
LOA ☐	Product Improvement ☐																																																																			
Substation ☐	Process Improvement ☐																																																																			
Past Expiry Date ☐	Manufacturing Process ☐																																																																			
Misidentified ☐	Past Due ☐																																																																			
☐ Pressure/Forced																																																																				
☐ Bending																																																																				
☐ Centre Not Concentric																																																																				
☐ Cracks																																																																				
☐ Crimp/Kink/Ripple/Wave																																																																				
☐ Cuffs																																																																				
☐ Crushing																																																																				
☐ Heat Treat																																																																				
☐ Wave/Twist in Tube																																																																				
☐ Marks/Chatter																																																																				
☐ Temperature/Cure																																																																				
☐ Set-up																																																																				
☐ BOM/Route																																																																				
☐ Broken/Damage/Defect																																																																				
☐ Inspection Incomplete/Unqualified																																																																				
☐ Contamination																																																																				
☐ Countersink																																																																				
☐ Cut Too Short																																																																				
☐ Instructions Incomplete/Unclear																																																																				
☐ Drill Holes																																																																				
☐ Power Loss/Surge																																																																				
☐ Folio/Program																																																																				
☐ Grain																																																																				
☐ Weld																																																																				
☐ Wrong Stock Pulled																																																																				
☐ Out of Sequence																																																																				
☐ Off-set																																																																				
☐ Mislabeled																																																																				
☐ Fit/Function																																																																				
☐ Misaligned/off center																																																																				
☐ Positioned Wrong																																																																				
☐ Outside Dimensions																																																																				
☐ Over/Under tolerance																																																																				
☐ Part Incorrect																																																																				
☐ Part Lost/Missing																																																																				
☐ Part Moved																																																																				
☐ Drawing																																																																				
☐ Finish																																																																				
☐ Misread																																																																				
☐ Turning Sequence																																																																				
OTHER : _____																																																																				

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER :					

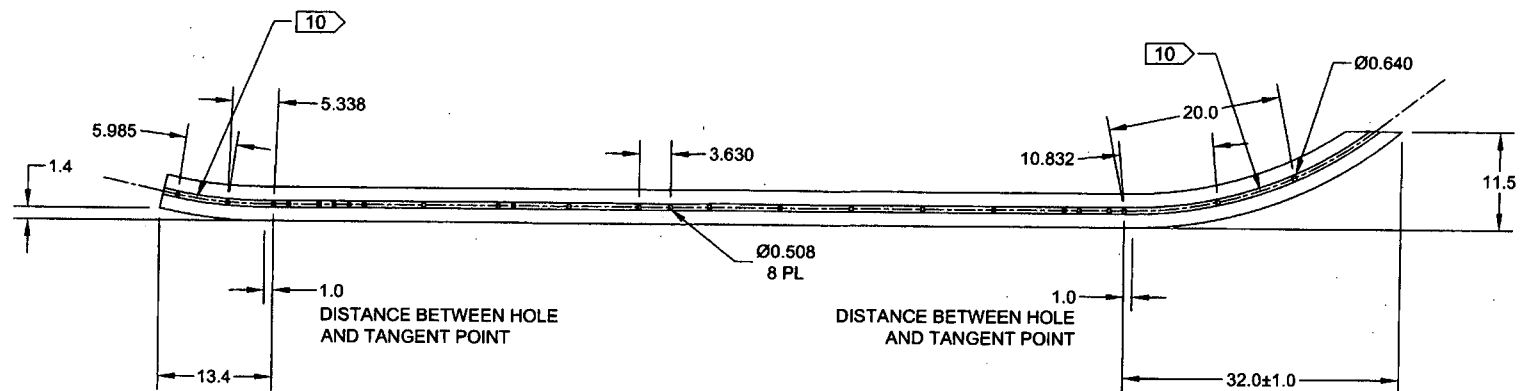

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	A	D2580	SHEET 8 OF 9
APPROVED	MP	TITLE	SCALE
DE APPR.	MP	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____





WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Skid-tube ☐</td> <td style="border: none;">Cross tube ☐</td> <td style="border: none;">Water Jet ☐</td> <td style="border: none;">Engineering ☐</td> </tr> <tr> <td style="border: none;">Machining ☐</td> <td style="border: none;">Small Fab ☐</td> <td style="border: none;">Prod. Eng. Coord. ☐</td> <td style="border: none;">Quality ☐</td> </tr> <tr> <td style="border: none;">Thermoforming ☐</td> <td style="border: none;">Finishing ☐</td> <td style="border: none;">Rec/Store/Packaging ☐</td> <td style="border: none;">Other ☐</td> </tr> <tr> <td style="border: none;">Large Fab ☐</td> <td style="border: none;">Composite ☐</td> <td style="border: none;">Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐																																																							
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																																																																												
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																																																																												
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																																																																												
Large Fab ☐	Composite ☐	Supplier ☐																																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																																								
Description Work Order Deviation				Disposition				Completed By																																																																							
Root Cause <table style="width: 100%; border: none;"> <tr> <td style="border: none;">Environment ☐</td> <td style="border: none;">No Re-verification ☐</td> <td style="border: none;">Pressure/Forced ☐</td> <td style="border: none;">Temperature/Cure ☐</td> <td style="border: none;">Power Loss/Surge ☐</td> <td style="border: none;">Positioned Wrong ☐</td> </tr> <tr> <td style="border: none;">Design ☐</td> <td style="border: none;">Operator ☐</td> <td style="border: none;">Bending ☐</td> <td style="border: none;">Set-up ☐</td> <td style="border: none;">Folio/Program ☐</td> <td style="border: none;">Outside Dimensions ☐</td> </tr> <tr> <td style="border: none;">Doc/Data ☐</td> <td style="border: none;">Offset/Setup ☐</td> <td style="border: none;">Centre Not Concentric ☐</td> <td style="border: none;">BOM/Route ☐</td> <td style="border: none;">Grain ☐</td> <td style="border: none;">Over/Under tolerance ☐</td> </tr> <tr> <td style="border: none;">Equip/Tooling ☐</td> <td style="border: none;">Supplier ☐</td> <td style="border: none;">Cracks ☐</td> <td style="border: none;">Broken/Damage/Defect ☐</td> <td style="border: none;">Weld ☐</td> <td style="border: none;">Part Incorrect ☐</td> </tr> <tr> <td style="border: none;">Handling/Pre ☐</td> <td style="border: none;">Training ☐</td> <td style="border: none;">Crimp/Kink/Ripple/Wave ☐</td> <td style="border: none;">Inspection Incomplete/Unqualified ☐</td> <td style="border: none;">Wrong Stock Pulled ☐</td> <td style="border: none;">Part Lost/Missing ☐</td> </tr> <tr> <td style="border: none;">Material ☐</td> <td style="border: none;">Use for Testing ☐</td> <td style="border: none;">Cuffs ☐</td> <td style="border: none;">Contamination ☐</td> <td style="border: none;">Out of Sequence ☐</td> <td style="border: none;">Part Moved ☐</td> </tr> <tr> <td style="border: none;">Internal Transport ☐</td> <td style="border: none;">Poor Information ☐</td> <td style="border: none;">Crushing ☐</td> <td style="border: none;">Countersink ☐</td> <td style="border: none;">Off-set ☐</td> <td style="border: none;">Drawing ☐</td> </tr> <tr> <td style="border: none;">Tribal Knowledge ☐</td> <td style="border: none;">Rushing ☐</td> <td style="border: none;">Heat Treat ☐</td> <td style="border: none;">Cut Too Short ☐</td> <td style="border: none;">Mislabeled ☐</td> <td style="border: none;">Finish ☐</td> </tr> <tr> <td style="border: none;">LOA ☐</td> <td style="border: none;">Product Improvement ☐</td> <td style="border: none;">Wave/Twist in Tube ☐</td> <td style="border: none;">Instructions Incomplete/Unclear ☐</td> <td style="border: none;">Fit/Function ☐</td> <td style="border: none;">Misread ☐</td> </tr> <tr> <td style="border: none;">Substation ☐</td> <td style="border: none;">Process Improvement ☐</td> <td style="border: none;">Marks/Chatter ☐</td> <td style="border: none;">Drill Holes ☐</td> <td style="border: none;">Misaligned/off center ☐</td> <td style="border: none;">Turning Sequence ☐</td> </tr> <tr> <td style="border: none;">Past Expiry Date ☐</td> <td style="border: none;">Manufacturing Process ☐</td> <td colspan="4"></td> </tr> <tr> <td style="border: none;">Misidentified ☐</td> <td style="border: none;">Past Due ☐</td> <td colspan="4"></td> </tr> </table>				Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐					Misidentified ☐	Past Due ☐					FAULT CATEGORY OTHER : ☐			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐																																																																										
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐																																																																										
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐																																																																										
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐																																																																										
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐																																																																										
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐																																																																										
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐																																																																										
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐																																																																										
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐																																																																										
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐																																																																										
Past Expiry Date ☐	Manufacturing Process ☐																																																																														
Misidentified ☐	Past Due ☐																																																																														

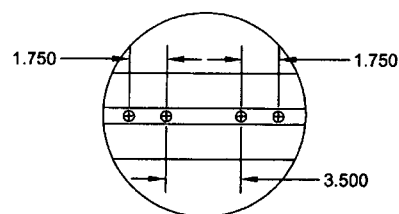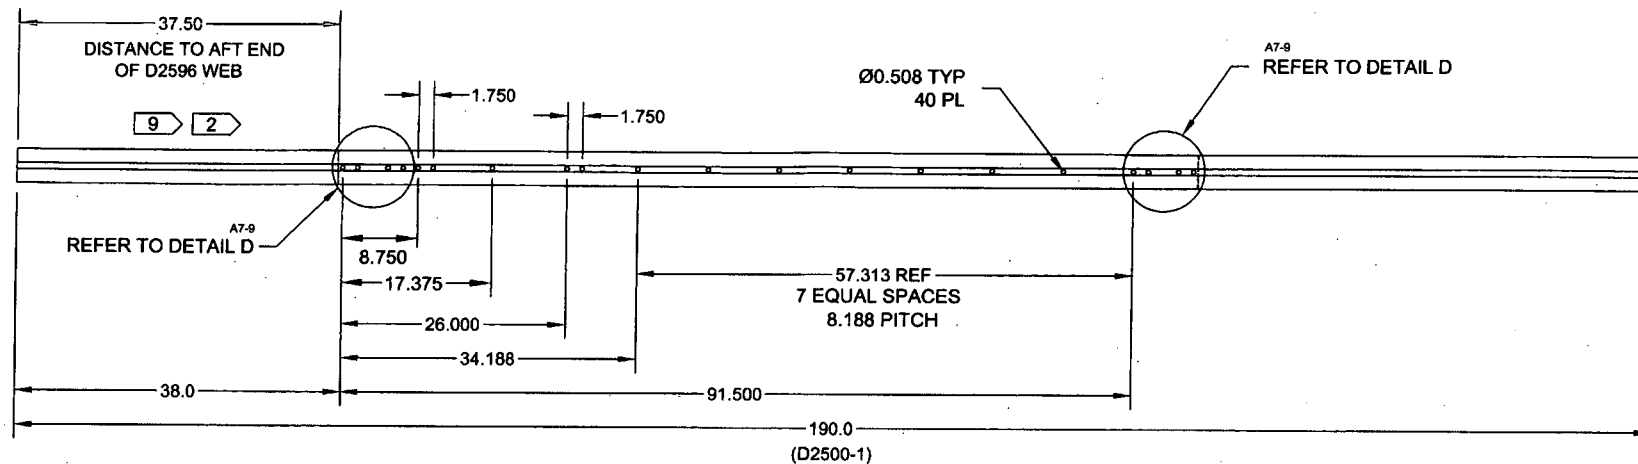

DETAIL D
SCALE 5X
C3-9
C7-9

D2580-101 TUBE

RELEASED
2014-04-29
MD

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 9 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					